

Manhole Inspection Summary

Manhole # S39GG_042MH

Printed On: 12/18/2008

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **39GG** Node: **042** Status: **Found**

Insp Date: **3/28/07 3:21 PM**

Incomplete Comments

Crew: **JS, MT**
Inspector: **Smutek, J**
Firm: **REI**

Location Address: **1324 HILLMAN ST**

Cross Street: **HOFFMAN ST**

Manhole Type: **Junction** Location: **Alley**

Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry**

Subject To Ponding: **None**

Comments **026 does not connect to this mh.**

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **2** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **3** (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☒ **Roots** ☒ **Wall**

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☒ **Roots** ☒ **Wall**

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **46** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☒ **Roots** ☒ **Wall**

Bench ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged ☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☒ **Deteriorated** ☐ Leaks ☐ Debris

Steps Count: **4** Missing: **0** ☒ **Corroded**

Surcharge ☒ **Evidence Of Surcharge** Depth: **1.5** (ft.) ☐ Active Surcharge Present

Location View



Top View




Corroded steps. Evidence of surcharge - Bench debris.

Defect



Frame leaks. Frame offset. Adjustment root intrusion, deterioration and infiltration.

Defect

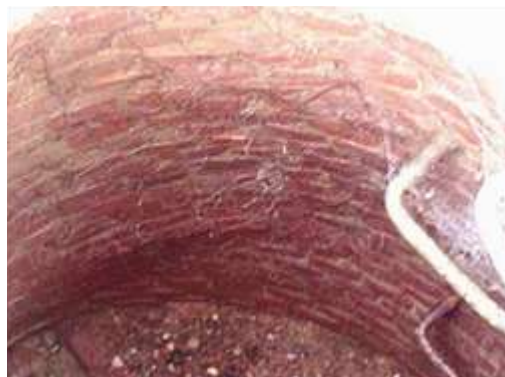

Adjustment, Corbel and Barrel root intrusion and infiltration.

Manhole Inspection Summary

Manhole # S39GG_042MH

Printed On: 12/18/2008

Page 3 of 4

8 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Channel deterioration. Barrel and Bench root intrusion.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.25** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☐ **Mud** ☐ Sludge ☐ **Debris** ☒ **Grease**

Silt Depth: **0** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Roots**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer Pipe In @ 6 O'Clock



Channel and Barrel root intrusion. Barrel deterioration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.87** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **0.5** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Roots**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S39GG_042MH

Printed On: 12/18/2008

Page 4 of 4

8 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock



Barrel deterioration and root intrusion.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.95** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **1** (in.) Deposits Extent: **Light**

Infiltration: **Evidence** Pipe Seal Cond: **Roots**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection